
ASSEMBLY INSTRUCTION

NO	PART LIST	QTY
1	BACK REST	1PC
2	SIDE PANEL (L)	1PC
3	SIDE PANEL (R)	1PC
4	FRONT SIDE RAIL	1PC
5	BACK SIDE RAIL	1PC
6	® LEG	4PCS
7	SLAT	2 SET
8	SLAT SUPPORT	1PC
9	SUPPORT LEG	2PCS
10	TRUNDLE FRONT RAIL	1PC
11	TRUNDLE BACK RAIL	1PC
12	TRUNDLE SIDE RAIL	2PCS
13	SLAT SLAT	2 SET
14	SLAT SUPPORT	3PCS
15	CASTOR	6PCS
ITEM	HARDWARE	QTY
A	JCBB SCREW M8 x 20MM	20PCS
В	JCBC SCREW M6 x 50MM	20PCS
C	SPRING WASHER	16PCS
D	FLAT WASHER (BIG)	4PCS
Е	FLAT WASHER (SMALL)	12PCS
F	SCREW M4 x 16MM	24PCS
G	SCREW M4 x 32MM	22PCS
Н	L - KEY M4 x 100MM	1PC
	L - KEY M5 x 65MM	1PC
I	IVIS X OSIVIVI	


STEP 1

Begin assembly by attaching each Leg (6) to the bottom of the Side Panel (2) & (3) securing with 2 Allen Bolt (B) per panel using L-key (H).

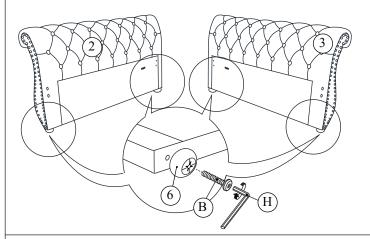


STEP 3

Attach the Back Rest (1) to the back of each Side Panel (2) & (3) by aligning the hole and securing with 2 Allen Bolts (B), 2 Spring Washer (C), 2 Flat Washer (D) from the back side per each end using L-key (H). (DO NOT FULLY TIGHTEN BOLTS FOR THIS STEP)

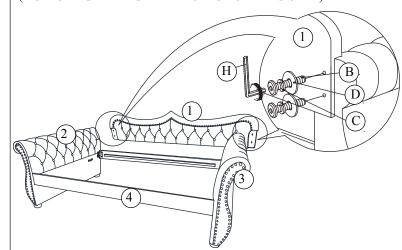


STEP 2

Attach the Front Rail (4) and Back Rail (5) to the Side Panel (2) & (3) aligning holes and securing with 2 Allen Bolts (A) per each end using L-key (I). (DO NOT FULLY TIGHTEN BOLTS FOR THIS STEP)

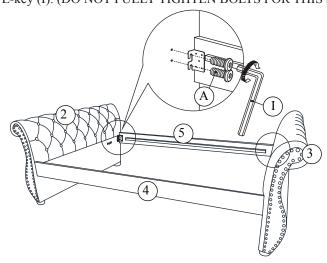

STEP 4

Secure 2 Support Leg (9) to the Slat Support (8) as shown on step 4.1. Insert the pre-set metal on Slat Support (8) to the metal bracket on each side of Side Panel (2) & (3). Then securing the metal bracket as shown in step 4.3 with 1 Screw (G) each side using Phillips Head Screwdriver (NOT INCLUDED)

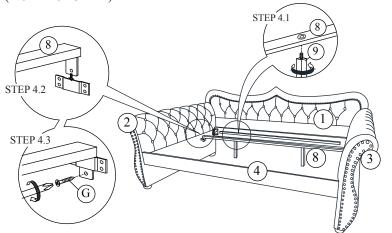


Please do not tighten the hardware until the entire assembly is completed.

ASSEMBLY INSTRUCTION

STEP 5


Tighten All Bolts from step 1 to step 4 by using L-key (I) & (J) that has been provided. Attached Slat (7) to Front Side Rail (4) & Back Side Rail (5) by unrolling and securing with 6 Screw (G), per set using Phillips Head Screwdriver. Securing Slat (7) to Back Side Rail (5) with 2 Screw (G) per each side as step 5.1. Following by step 5.2, using 1 Screw (G) to secure Slat (7) to Front Side Rail (4).

Repeat the same step to attach another set of Slat (7).

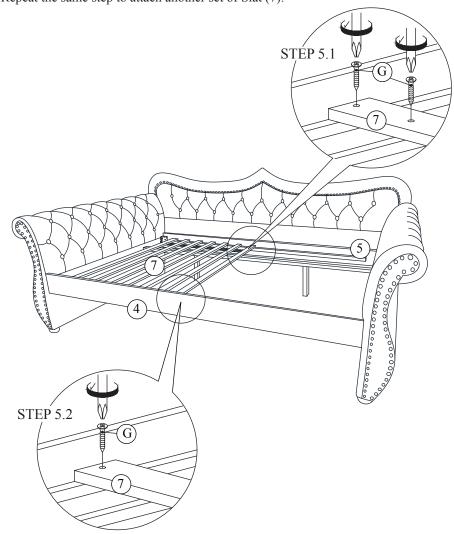


STEP 6

Attach the Stopper (J) to the front side of Side Panel (2) & (3) each side by securing with 2 Allen Bolt (A) using L-key (I) to avoid trundle pull out.

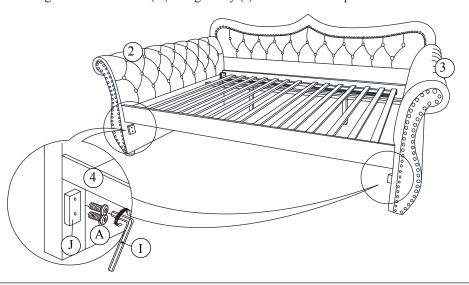


STEP 7

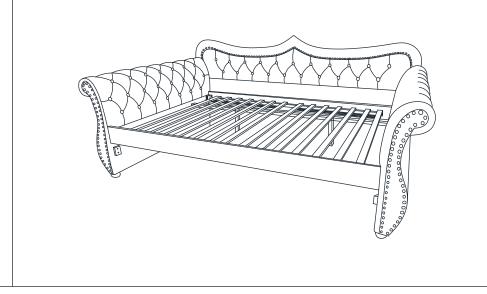

Please do not tighten the hardware until the entire assembly is completed.

ASSEMBLY INSTRUCTION

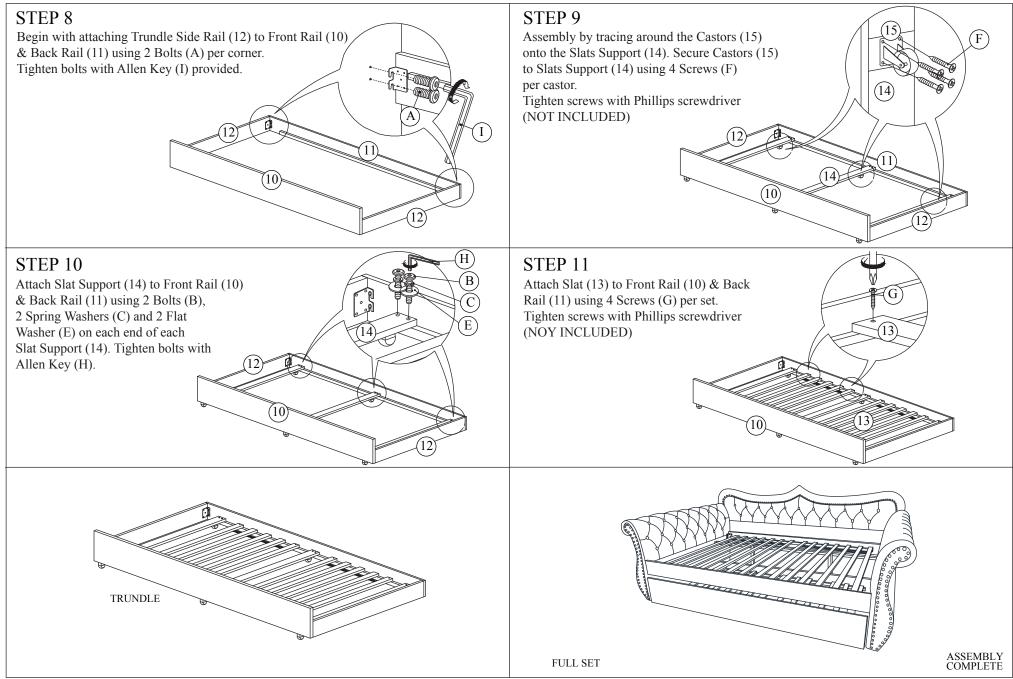

Please do not tighten the hardware until the entire assembly is completed.